





Remove Scanner from box to install the interface cable.




Remove the screw at the base of the Scanner holding the cable clamp.

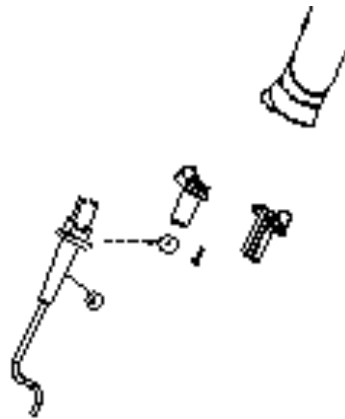


Separate the clamp into 2 pieces by sliding the 2 sides of the cable clamp in opposite directions.

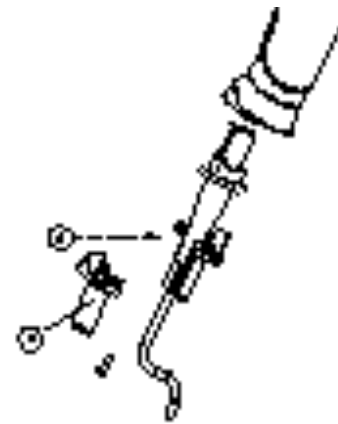

Place the interface cable between the two halves of the clamp.

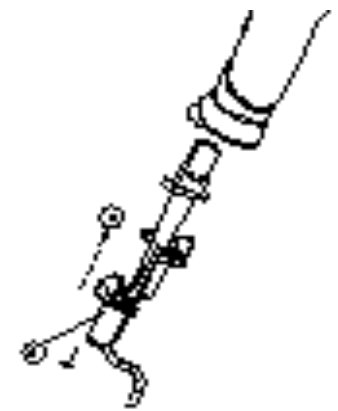


With the cable between them slide both parts of the clamp together until they lock into place.

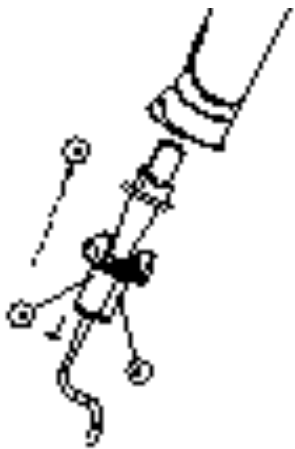


Pull the cable downwards until the top of the clamp meets the widest part of the cable.




Paying attention to its orientation insert the cable connector into the socket at the base of the scanner.

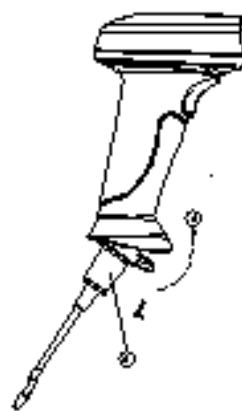

Slide the clamp slightly backwards and lock it into position

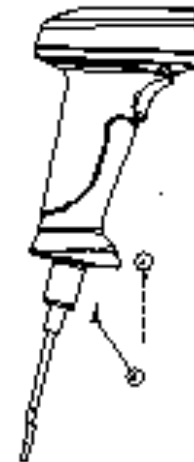

Insert the screw into screw hole and tighten firmly

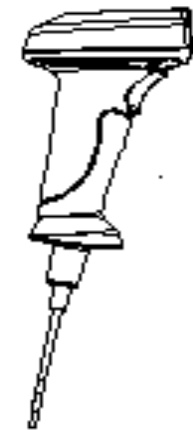

Your Scanner is now ready for use.